




Jan.1.2022 Copyright 2022 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

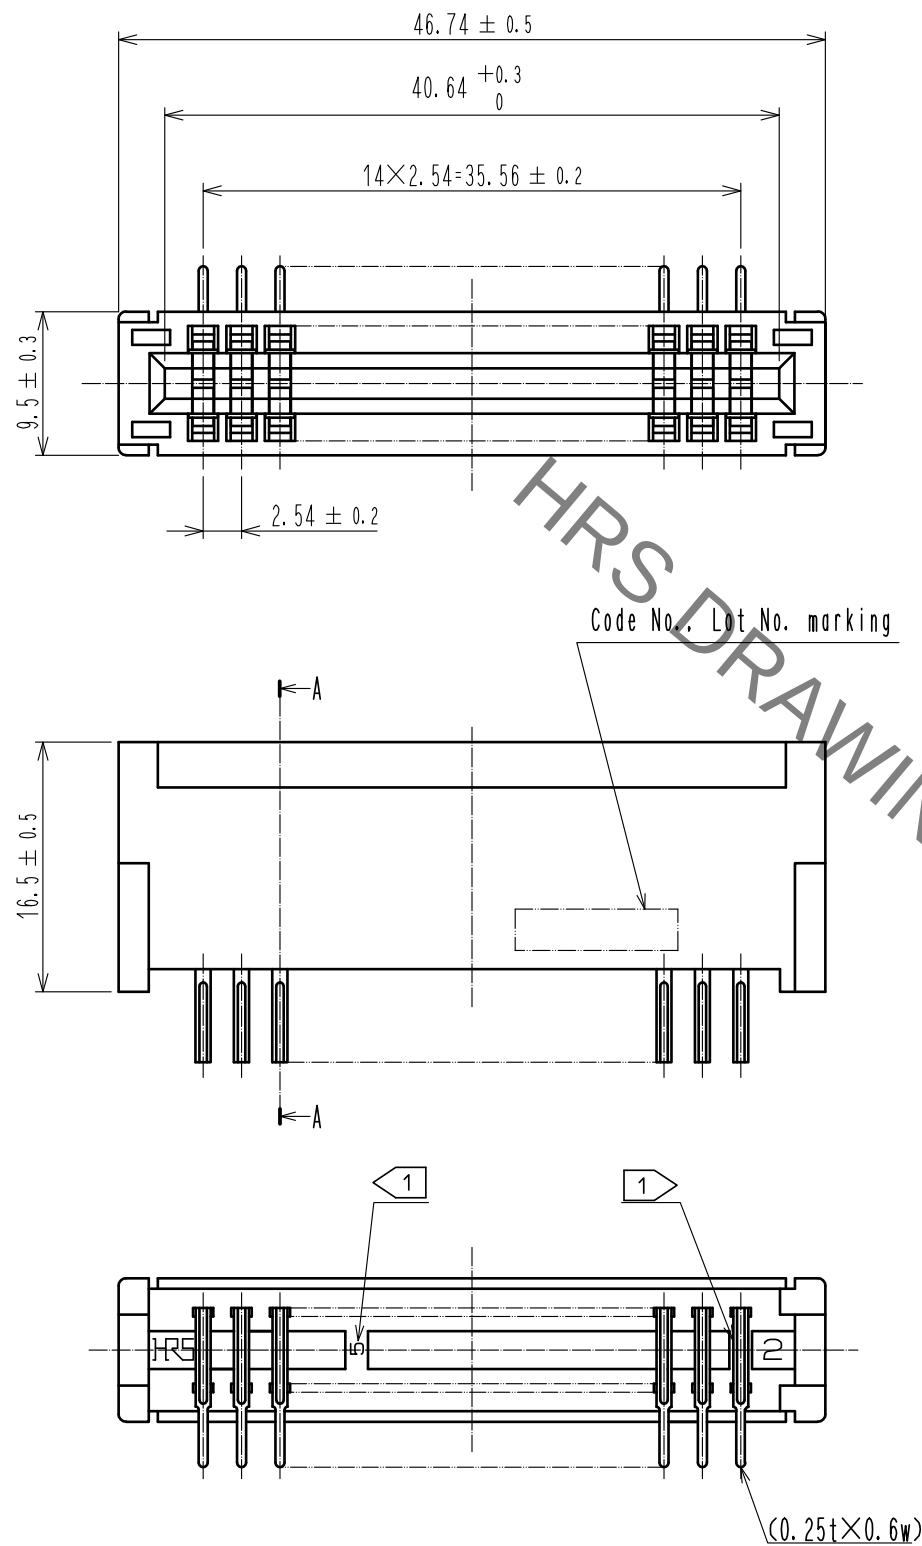


Recommended PC board hole pattern ($t=1.6 \pm 0.1$)

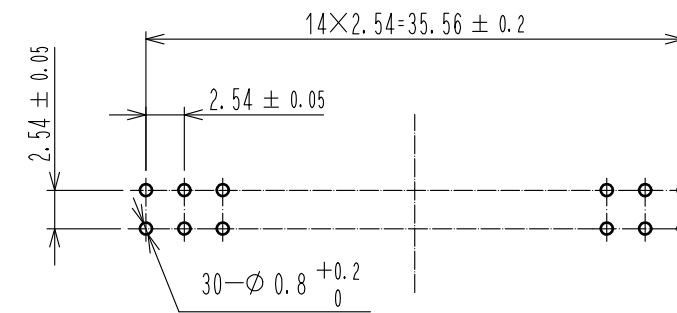

A-A

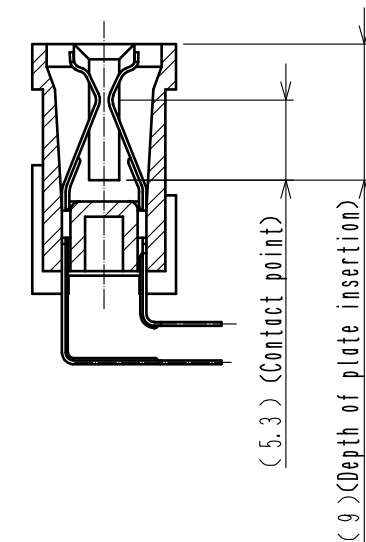

- Notes
- 1 Contact No. (5, 10, 15) are shown.
 - 2 A polarizing key inserted between the following contact positions. (5 to 6), (10 to 11).
 - 3 The dimensions in parentheses are for reference.

2	PHOSPHOR BRONZE	(Contact area) Ni2.5 μ m+Au0.05 μ m (Mounting area) Ni2.5 μ m+Sn2 μ m		3	PHOSPHOR BRONZE	(Contact area)Ni2.5 μ m+Au0.05 μ m (Mounting area) Ni2.5 μ m+Sn2 μ m			
1	PBT	BLACK UL94V-0							
NO.	MATERIAL	FINISH . REMARKS			NO.	MATERIAL	FINISH . REMARKS		
UNITS mm		SCALE 2 : 1		COUNT 1	DESCRIPTION OF REVISIONS DIS-F-00003693		DESIGNED TM. NAKAJIMA	CHECKED HT. YAMAGUCHI	DATE 18.09.11
 HIROSE ELECTRIC CO., LTD.		APPROVED : HT. YAMAGUCHI			DRAWING NO. EDC-018056-70-02				
		CHECKED : HT. YAMAGUCHI			PART NO. CR22A-30D-2.54DSA(70)				
		DESIGNED : TY. EDAGAWA			CODE NO. CL522-0034-0-70				
		DRAWN : MK. OKI			 				